
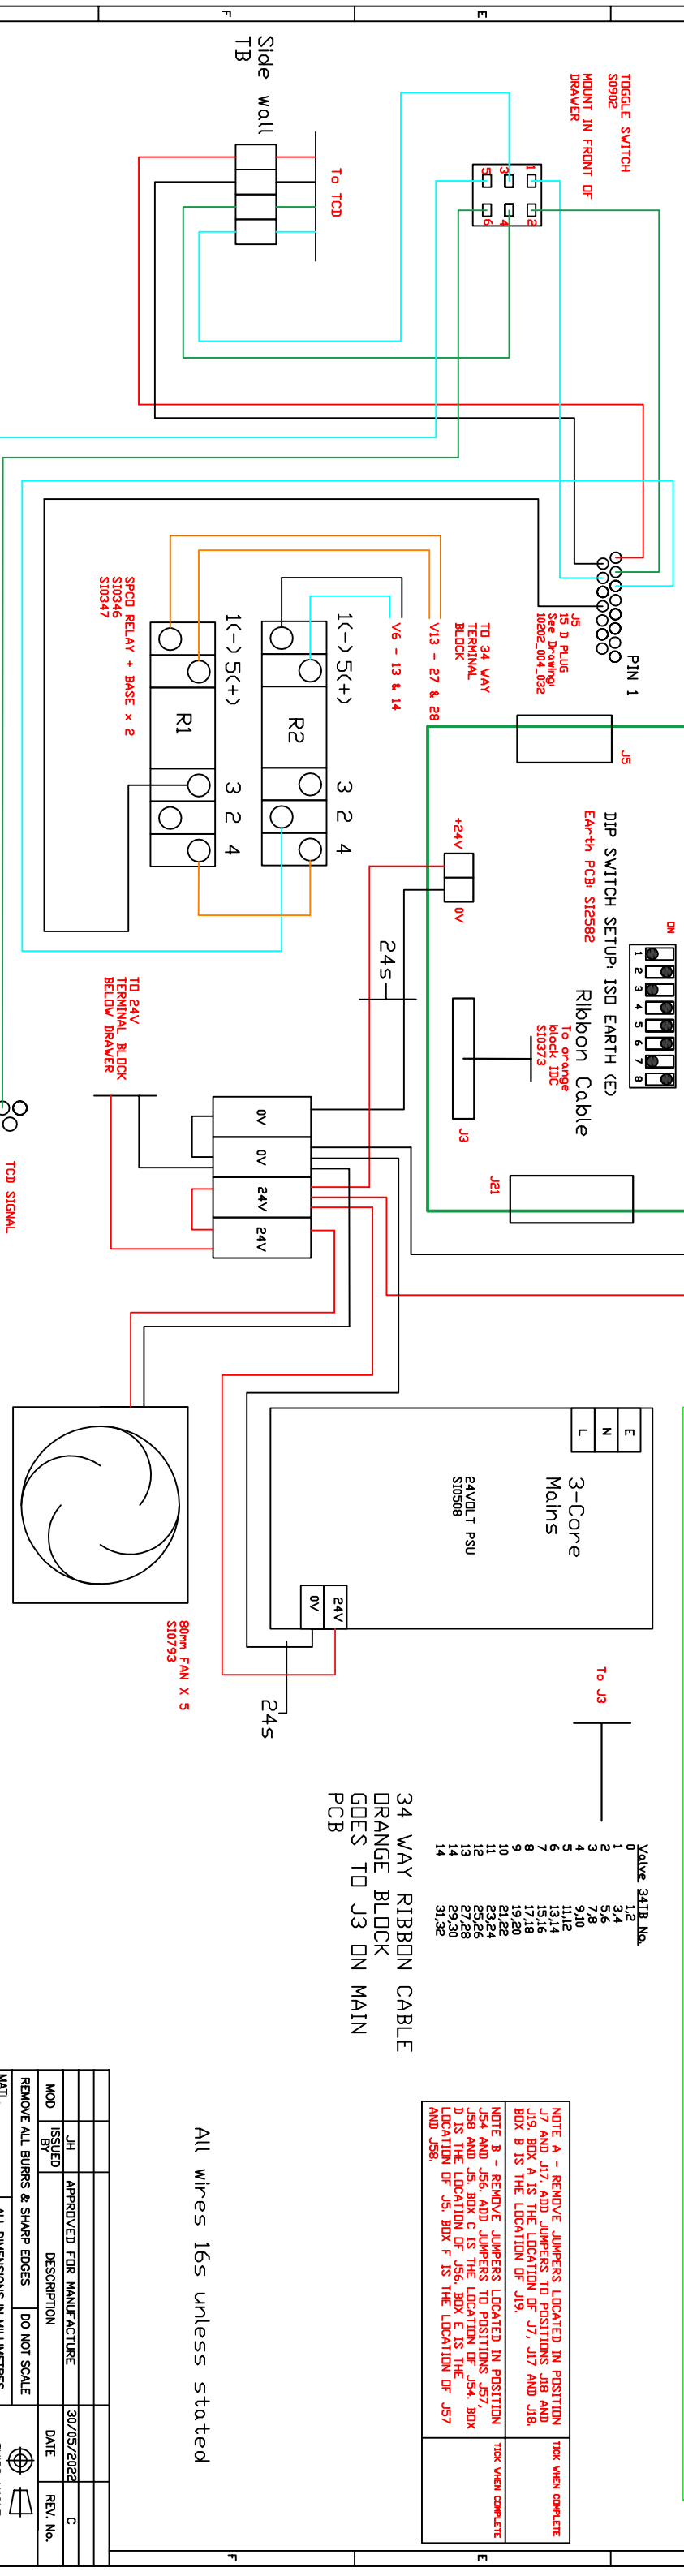


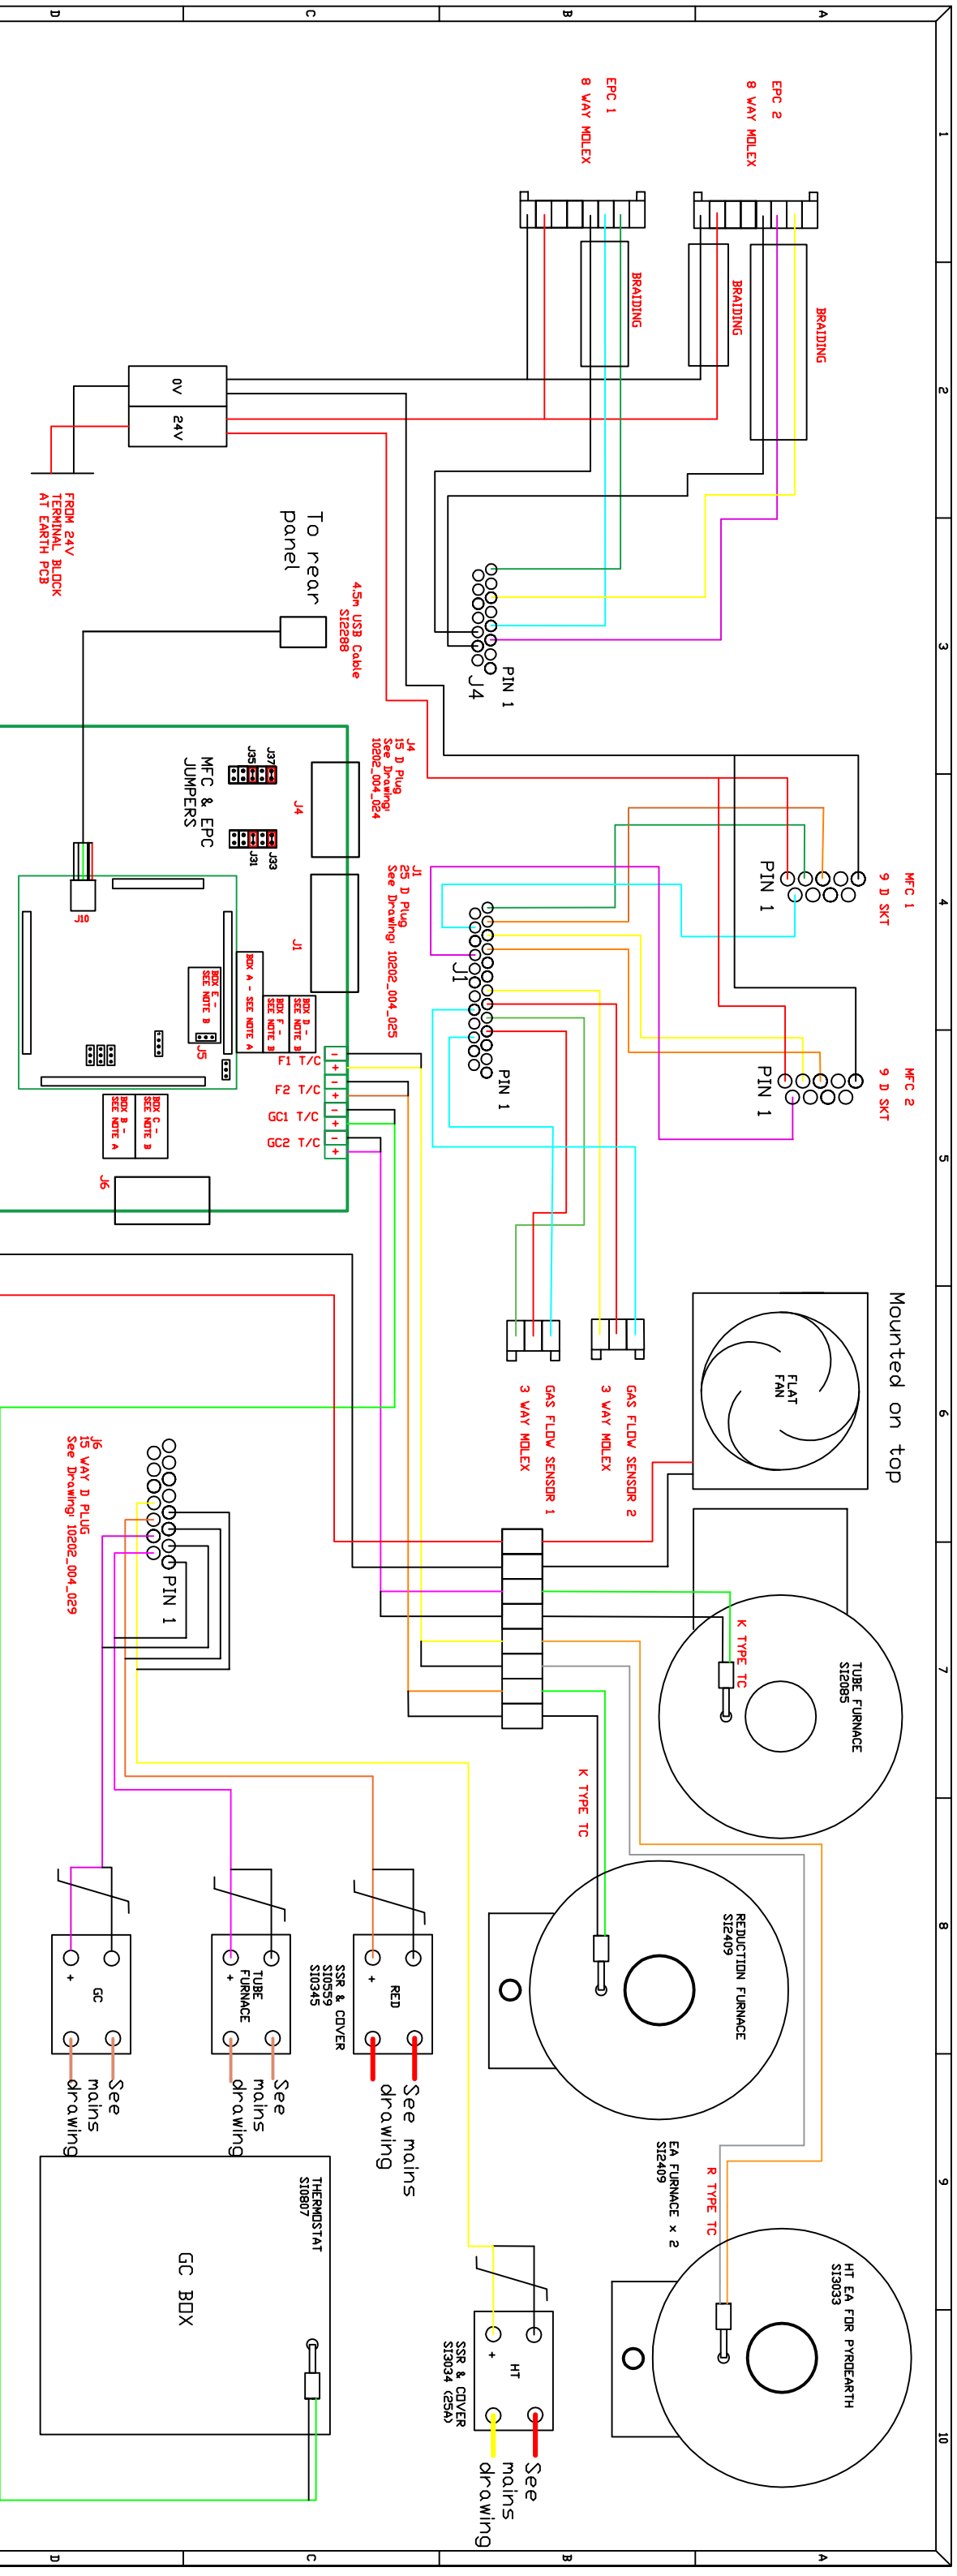

NOTE A - REMOVE JUMPERS LOCATED IN POSITION J7 AND J17. ADD JUMPERS TO POSITIONS J18 AND J19. BOX A IS THE LOCATION OF J7, J17 AND J18. BOX B IS THE LOCATION OF J19.

NOTE B - REMOVE JUMPERS LOCATED IN POSITION J54 AND J56. ADD JUMPERS TO POSITIONS J57, J58 AND J5. BOX C IS THE LOCATION OF J54. BOX D IS THE LOCATION OF J56. BOX E IS THE LOCATION OF J5. BOX F IS THE LOCATION OF J57 AND J58.

TICK WHEN COMPLETE

TICK WHEN COMPLETE

34 WAY RIBBON CABLE
DRANGE BLOCK
GOES TO J3 ON MAIN
PCB

All wires 16s unless stated

	JH	APPROVED FOR MANUFACTURE	30/05/2023	C
MOD	ISSUED BY	DESCRIPTION	DATE	REV. No.
REMOVE ALL BURNS & SHARP EDGES		DO NOT SCALE	 THIRD ANGLE	
MATERIAL		ALL DIMENSIONS IN MILLIMETRES		
FINISH		TOLERANCES UNLESS OTHERWISE STATED		
		±0.15° ANGULAR	0.00	±0.1
		SURFACE FINISH 1.8μ	0.0	±0.2
TITLE		SCALE		
PyroEarth WIRING – PREP				
SERCON LTD			DRG No	10202-005-002

